

ENVIRONMENTAL PROTECTION AGENCY, STATE OF ILLINOIS

L P C F C O 5 5 C
(1) _____ (8) (9)

EPA Region 5 Records Ctr.

INSPECTION REPORT - SITE INVENTORY NO.

(11) 2225002 (18)

343100

Co. - L.P.C.

Region

~
(19)Date 04-15-82
(20) (25)

Letter Sent (Yes or No)

(26)

Lockport

1 Wasteland

(Location)

(Responsible Party)

Samples Taken: Yes (X) No () Time: From 08:30 a.m.

Ground Water() Surface() Other (X) To 09:40 a.m.

Photos Taken: Yes (#) No () Interviewed T. Buntin & Company

Weather clear ~60° dry

Inspector / A S
(27) (29)

Previous Inspection 4/12/82 Previous Correspondence 4/12/81

OPERATIONAL STATUS: TYPE OF OPERATION:

Operating (X)	Sanitary Landfill (o)	Storage ()
Temporarily Closed ()	Random Dump ()	Salvage ()
Closed Not Covered ()	Other ()	A.C.D. ()
Closed and Covered ()	Quantity Received Daily (1-6) 2	(30)

Operating: Yes (X) No ()

AUTHORIZATION:

E.P.A. Permit (X)
Variance ()
21 (d) ()
Board Order ()
Illegal (5) ()

RECEIVED (31)

SITE EVALUATION

Leachate:	Ponded on site (X)	32
	Flowing on site (X)	33
	Seeping (X)	34
	Evidence of past flows (X)	35
	Observed garbage () refuse () in standing water (X) STATE (ILLINOIS)	36
	Flow entering surface water (5).	37
	Flow leaving site (1-3)	38
Board Order:	Violation observed (5)	39
Court Order:	Violation observed (5)	40
Permit:	One violation (5)	41
Daily Cover:	Additional violation(s) (2)	42
	Not provided on previously deposited refuse (5)	43
	Not provided on previous operating day (4)	44
	Inadequate depth over area \geq 3 days operation (3)	45
	Inadequate depth over area \leq 2 days operation (1-2)	46
Intermediate Cover:	Inadequate depth in required areas in acres (1-3)	47
Final Cover:	Inadequate depth 1-3 acres (1-3)	48
	Inadequate depth 3 or more acres (4)	49
	None 60 days after area closure (5)	50
Unloading not supervised(3)		51
Refuse not deposited at toe of slope(X)		
Inadequate spreading and compacting (X)		
Insufficient operable equipment on site as required ()	(2 ea. 2-8)	52
Operational roads unsatisfactory ()		
Blown litter(X) dust nuisance observed() Odor detected() (1 ea. 1-3)		53
Burning (4)		54
Liquids() Solids(X) not permitted (5)		55
Inadequate site restriction() Site concealment() (2 ea. 2-4)		56
Inadequate Shelter() Sanitary Facilities() Emergency Communications() (1 ea. 1-3)		57
Scavenging by: Operator() Others() observed (1-3)		58
Salvaging Observed(): Improperly conducted in: Location() Operation() Storage() (1-3)		59
Evidence of vectors observed () (1-3)		60
Other (1-3)		61

Much improvement needed - cinders unusable cover material

Cheri L. Biseley, Secretary

ENVIRONMENTAL PROTECTION AGENCY STATE OF ILLINOIS
INTER-OFFICE CORRESPONDENCE



RECEIVED

DATE: 4/15/82

MAY 24 1982

MEMO TO: File 14705002

EPA - D.L.P.C.
STATE OF ILLINOIS

FROM: VAS

SUBJECT: Will COUNTY - D.L.P.C. Inspection


Groceryport / wasteland

GENERAL REMARKS: Neither Roger Pemble or Ed Kanive was available at the time of my inspection. A sign from the County Zoning Board was found on the door of the on-site trailer, declaring the site a public nuisance. The number of loads entering the site definitely appears reduced from what was observed last visit. The additional following items were also noted:

- Most of the northern 3/4 of the site has been covered with the red cinder material. Much of this area was littered with blown papers and plastic items.
- Deposition and spreading of incoming refuse was occurring

DIAGRAM:

LPC-19

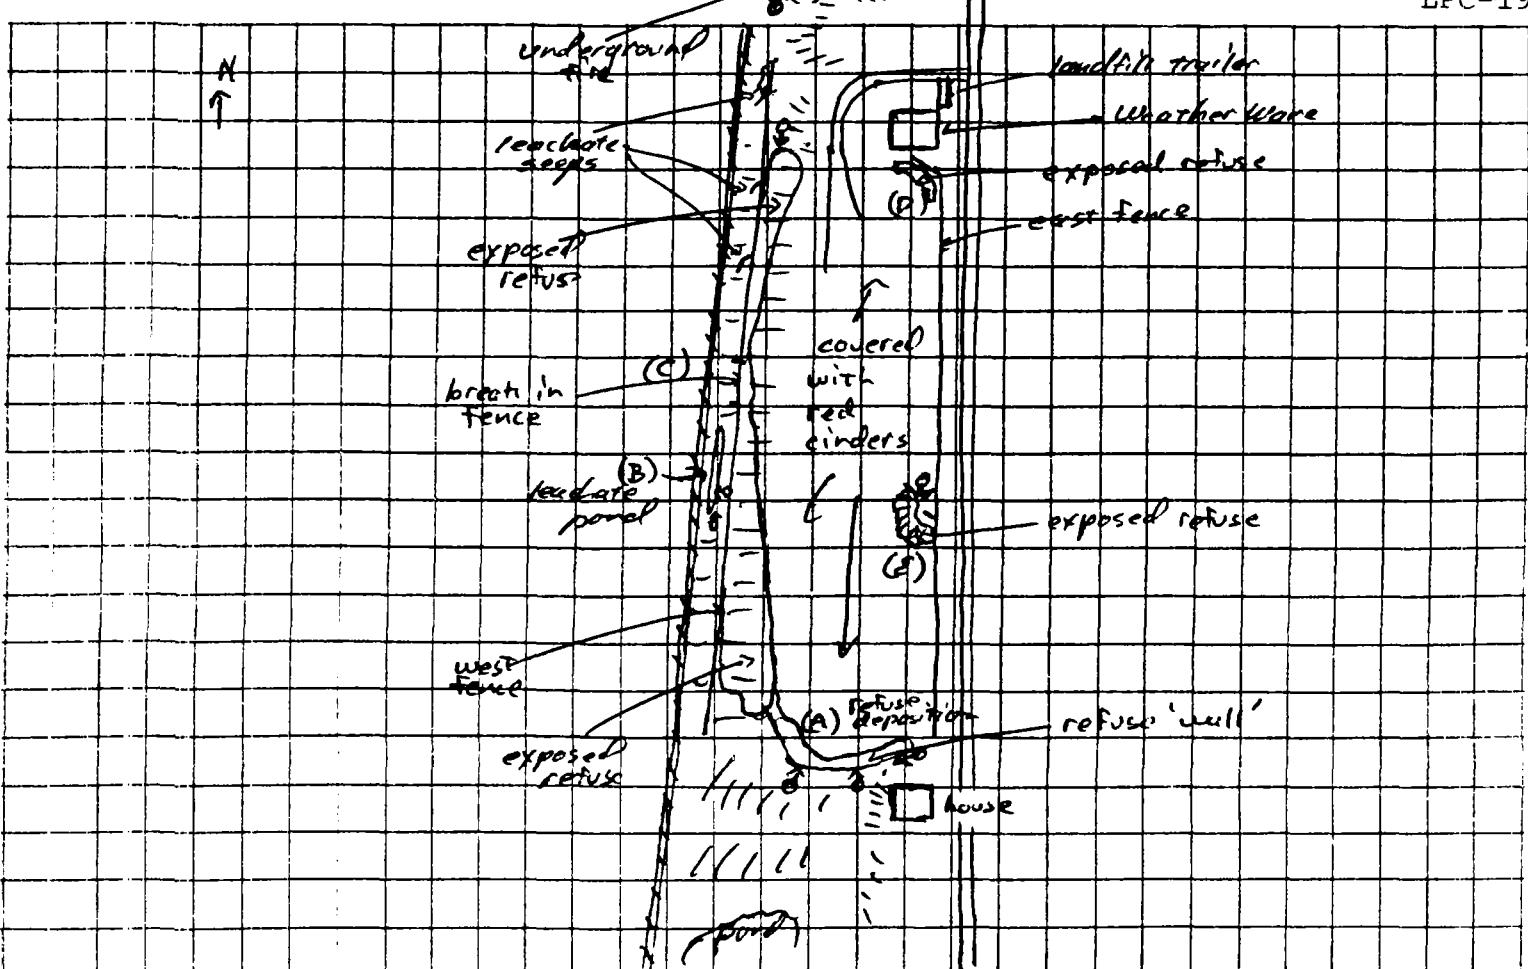

DivisionDATE: 4/15/82FROM: Stratterahn Information onlySUBJECT: Fill Co - 14705002 - Lockport/Wasteland Response requested

- at (A). Refuse from this fill area was contiguous with exposed refuse refuse along the southern edge of the active lift and on the west slope of the landfill, above the west fence. In similar fashion as to that described in the 4/12/82 report, incoming refuse is deposited atop the edge of the active lift, which is still progressing southward, and pushed over the edge of the lift by the one cat working there. A resultant "wall" of refuse, from approximately 10 to 15 feet high, was found. ~~approximately 15 feet high.~~ (AS)
- Leachate was found ponded in the railroad right-of-way, at (B). The liquid possessed a orange surficial film with a metallic sheen, the underlying solution was turbid, a definite leachate-like odor accompanied the liquid. This pond was sampled. It was located ~~at~~ roughly between 30 and 5 feet from the edge of the railroad track.
- Leachate was also found seeping along the west slope. A few ^{seeps} were found just below the west fence, north of the break at (C). Others were found around the north terminus of the west fence.
- ^{other} 2 areas of exposed refuse were seen, one at the northeast corner at (D), and one in the depressed area around the culvert at (E). Paper and cardboard were the predominant refuse types here.
- Paper, cardboard and domestic refuse and garbage predominated among the types of refuse noted along the south edge of the active lift and the west slope. Tires, scrap wood and metal were also present, approximately 5yd³ of Pilet refuse was spread near A.
- At (F), a small hole was found in the cover in which a copious amount of smoke, which smelled like burning papers, was emerging.



ILLINOIS ENVIRONMENTAL PROTECTION AGENCY

MEMORANDUM

TO: Division DATE: 4/18/82

FROM: Steffenuhn

SUBJECT: WILL CO - 19705002 - Lockport/Wasteland

Information only

Response requested

The clay and rock around the hole was covered with an apparent black soot material. Lesser amounts of smoke was also seen emerging from a few cracks in the near vicinity of this hole. When this was mentioned to Tom Barnette, the cut operator, at the completion of the inspection, he replied that this was probably from the fire which occurred here about a year ago. He also said he would be digging up the area and putting a good seal of clay over it.